KUBICEK

issues

SERVICE INSTRUCTION no. 2024/03 Loose passenger handle line

With reference to: Kubicek Ballons K-series baskets


Action: Regaining friction of upper handle line after repair of wickerwork

Required material:

Part	Part Number	Quantity
Cable tie 200 x 4,8 mm	714.00	As required
3 mm nylon line	517.00	As required

Procedure:


- 1. Identify loose handles. Locate the handles that are loose and need securing.
- 2. Using a 3 mm nylon line, wrap it around the thick rope where the handle begins. Secure the wrapping by tying knots at both ends of the nylon line (refer to the image below for proper technique).

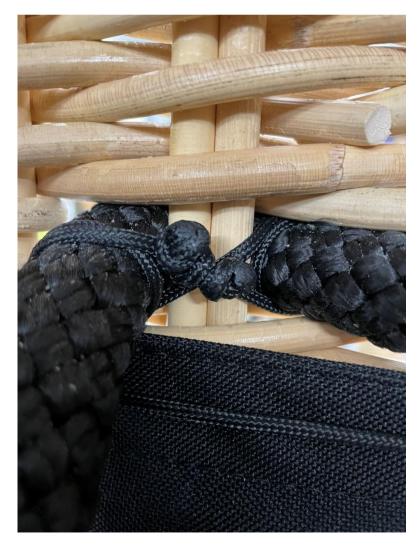

KUB_65D rev. a 1/2

KUBICEK

3. To ensure sufficient friction between the thick rope and the wickerwork, place cable ties around the wicker near the base of the handle. Make sure to position the cable ties so that the locking mechanism is hidden within the woven structure, protecting passengers from any sharp edges (refer to the image below for placement).

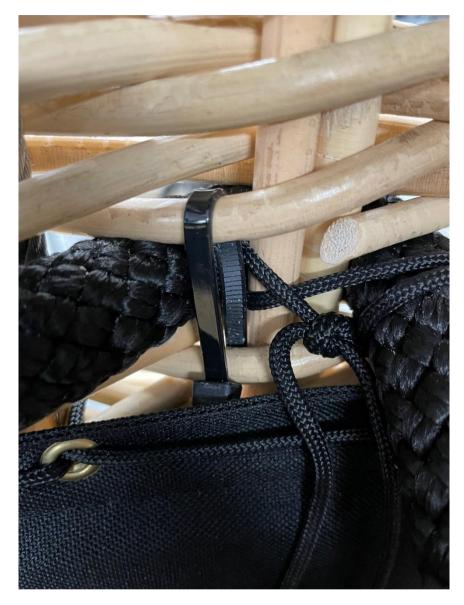

- 4. Cut off the excess ends of the cable ties for a neat finish.
- 5. Apply the same process to all handles that need securing.

Technical content of this document is approved under the authority of DOA No. EASA.21J.277.

On behalf of Kubíček Factory s.r.o.

Ing. Petr Kubíček, technical director

Datum: 25.09.2024

KUB_65D rev. a 2/2